



Total Quality. Assured.
TEST REPORT



中国认可
国际互认
检测
TESTING
CNAS L0220

Number: GZHT90798854

Date: May 31, 2018

Applicant: PORTWEST LTD FUZHOU OFFICE
ROOM 1104 FUZHOU INTERNATIONAL
FINANCIAL CENTER NO.1 WANGLONG 2ND
ROAD TAIJIANG AREA FUZHOU CITY
FUJIAN PROVINCE CHINA
Attn: MAY

Sample Description:

Three (3) groups of submitted samples said to be:

- (A) Three (3) pairs of Women's safety shoes in Black/Blue
- (B) One (1) pair of Women's safety shoes in Black/Pink
- (C) Three (3) pairs of Steel plates


Standard : ASTM F2413-17
 Size : US 8
 Colors : Black/Pink and Black/Blue
 Ref. No. : FW39
 Insert Plate : 1859# Steel plate
 Toe Cap : 802# Steel toe cap
 Sole Material : PU/PU
 Shoe Type : Safety shoes
 Age Range : Adult
 Buyer : Portwest
 Ref. : FW39 Ladies safety Trainer S1P
 Date Received/Date Test Started: May 24, 2018
 Date Final Information Confirmed/ --/--
 Date Payment Received:

Test Result Please Refer To Attached Page(S).

Should you have any query on this report, you may contact at gzfootwear@intertek.com

Authorized By:
For Intertek Testing Services Shenzhen Ltd.
Guangzhou Branch

Huang Ning, Andy
Assistant General Manager

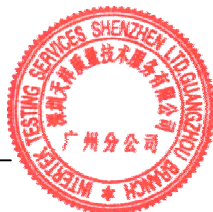

EC / lydiayang

Intertek Testing Services Shenzhen Ltd, Guangzhou Branch

深圳天祥质量技术服务有限公司广州分公司

Room 02, 1-8/F. & Room 01, E101/E201/E301/E401/E501/E601/E701/E801,
No.7-2, Caipin Road, Guangzhou Science City, GETDD, Guangzhou, Guangdong, China
广州经济技术开发区科学城彩频路7号之二第1-8层02房、01房101、
E201、E301、E401、E501、E601、E701、E801
Tel: +86 208213 9001 Fax: +86 20 82089909 Postcode: 510663

3/F., Hengyun Building, 235 Kaifa Ave., Guangzhou
Economic & Technological Development District, Guangzhou,
China
中国广州经济技术开发区开发大道235号恒运大厦3楼
Tel: +86 20 83966868 Fax: +86 20 82228169 Postcode: 510730



1 Protective Toe Impact Resistance (ASTM F2412-18, 5, I/75)

	(A)	<u>ASTM F2413 Requirement</u>	<u>Pass/Fail</u>
	Interior Height Clearance		
Left:	20.3 mm	≥ 11.9 mm	Pass
Right:	19.5 mm	≥ 11.9 mm	Pass
Left:	19.2 mm	≥ 11.9 mm	Pass

2 Protective Toe Compression Resistance (ASTM F2412-18, 6, C/75)

		<u>ASTM F2413 Requirement</u>	<u>Pass/Fail</u>
	Interior Height Clearance		
(A) Right:	24.2 mm	≥ 11.9 mm	Pass
(B) Left:	24.5 mm	≥ 11.9 mm	Pass
(B) Right:	24.3 mm	≥ 11.9 mm	Pass

3 Puncture Resistance Footwear (PR) (ASTM F2412-18, 11)

	(C)	<u>ASTM F2413 Requirement</u>	<u>Pass/Fail</u>
Left:	The Test Pin Did Not Penetrate Beyond The Face Of The Material Nearest The Foot Before 1200 N.	Min. 1200 N (*)	Pass
Right:	The Test Pin Did Not Penetrate Beyond The Face Of The Material Nearest The Foot Before 1200 N.	Min. 1200 N (*)	Pass
Right:	The Test Pin Did Not Penetrate Beyond The Face Of The Material Nearest The Foot Before 1200 N.	Min. 1200 N (*)	Pass

Remark: * = The Test Pin Does Not Visually Penetrate Beyond The Face Of The Material Nearest The Foot.

End Of Report

This report is made solely on the basis of your instructions and/or information and materials supplied by you. It is not intended to be a recommendation for any particular course of action. Intertek does not accept a duty of care or any other responsibility to any person other than the Client in respect of this report and only accepts liability to the Client insofar as is expressly contained in the terms and conditions governing Intertek's provision of services to you. Intertek makes no warranties or representations either express or implied with respect to this report save as provided for in those terms and conditions. We have aimed to conduct the Review on a diligent and careful basis and we do not accept any liability to you for any loss arising out of or in connection with this report, in contract, tort, by statute or otherwise, except in the event of our gross negligence or wilful misconduct.

GZHT90798854

